









**Elektrischer Anschluss / Raccordement électrique / Electrical connection**

Schutzart/ Protection	IP65 <sup>2)</sup>	IP69K	IP69K <sup>2)</sup>	IP67 <sup>2)</sup>
Ausführung Connexion électr. Electrical connection	EN175301-803-A (DIN43650-A)	Cable*	DIN 72585* Code 1	MIL-C 26482
Ausgangssignal Signal de sortie Output	<b>04/05</b> 	<b>78</b> Abschirmung écran / shield 	<b>25</b> 	<b>02</b> 
 <b>829X.XX.XXXX.XX.19</b>	standard 2 1 	with accessory <b>92</b> 1 2 	blue: not conn. brown black yellow/green	- - - A B E
 <b>829X.XX.XXXX.XX.23</b>			brown blue black yellow/green	1 2 4 3

\*Entlüftung über das Kabelende/ Ventilation par extrémité du câble/ Ventilation via cable end
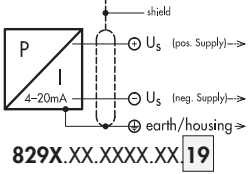
<sup>2)</sup> Ausführung/ Connexion électrique/ Electrical connection 04/05/25/02: nur mit vorschriftsmässig montierter Kabeldose gültig/ valable seulement avec fiche femelle montée selon instructions/ provided female connector is mounted according to instructions

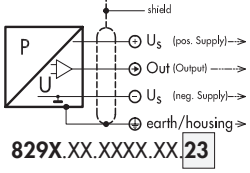Output	Load resistance	I <sub>SUPPLY</sub>	U <sub>SUPPLY</sub>	
4 ... 20 mA	(U <sub>Supply</sub> -9V)/20mA		9 ... 32 VDC	829X.XX.XXXX.XX.19..
0.5 ... 4.5 VDC	≥15.0 kΩ	≤12 mA	5 VDC ±0.25 VDC ratiometrisch/ ratiométrique/ ratiometric	829X.XX.XXXX.XX.23..

**Anziehdrehmoment Druckanschluss/ Couple de serrage raccord de pression / Torque moment pressure connection**

<b>829X.XX.XX17.XX...</b>	G 1/4": 25 Nm ± 5Nm
<b>829X.XX.XX19.XX...</b>	R 1/4": anwendungsspezifisch/dépend de l'application/depending on application
<b>829X.XX.XX11.XX...</b>	G 1/2": 25 Nm ± 5Nm (Manometer/ manomètre/ manometer)
<b>829X.XX.XX30.XX...</b>	NPT 1/4": 25 Nm ± 5Nm
<b>829X.XX.XX51.XX...</b>	NPT 1/2": 25 Nm ± 5Nm
<b>829X.XX.XX28.XX...</b>	M14x1.5 (Kegeldichtung/ Joint conique/ Conical seal: 58°): 30 Nm ± 5Nm
<b>829X.XX.XX29.XX...</b>	M18x1.5 (Kegeldichtung/ Joint conique/ Conical seal: 58°): 30 Nm ± 5Nm

**Umgebungstemperatur / Température ambiante / Ambient temperature**

-40°C ... +125°C (-40°F ... +260°F)

**Lagertemperatur / Température de stockage / Storage temperature**


-40°C ... +125°C (-40°F ... +260°F)

# Überdruck / Surpression / Overpressure


Nenndruck Pression nominal Nominal pressure		Überdruck Surpression Overpressure	
[bar]	[psi]	[bar]	[psi]
0 ... 2.5	0 ... 30	5	70
0 ... 4.0	0 ... 50	8	115
0 ... 6.0	0 ... 100	12	170
0 ... 10	0 ... 150	20	290
0 ... 16	0 ... 250	32	464
0 ... 25	0 ... 400	50	725
0 ... 40	0 ... 500	80	1160
0 ... 60	0 ... 1000	120	1740
0 ... 100	0 ... 1500	200	2900

Nenndruck Pression nominal Nominal pressure		Überdruck Surpression Overpressure	
[bar]	[psi]	[bar]	[psi]
0 ... 160	0 ... 2000	320	4640
0 ... 250	0 ... 3000	500	7250
0 ... 400	0 ... 5000	800	11600
0 ... 600	0 ... 7500	1000	14500
0 ... 1000	0 ... 10000	1800	26100
0 ... 1600	0 ... 20000	3000	43500
0 ... 2000	0 ... 30000	3000	43500
0 ... 2500	0 ... 35000	3000	43500

## Massbilder / Cotes d'encombement / Dimensions

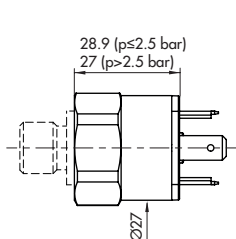


829X.XX.XX.XX.04.XX.XX

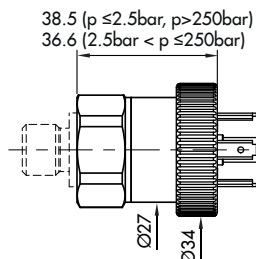


829X.XX.XX.XX.05.XX.XX

### To align the connector:


1. Remove the female connector
2. Release the black nut
3. Adjust the pins (max. ± 120°)
4. Tighten the black nut

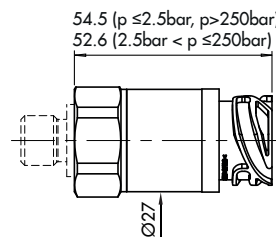


829X.XX.XXXX.25.XX.XX

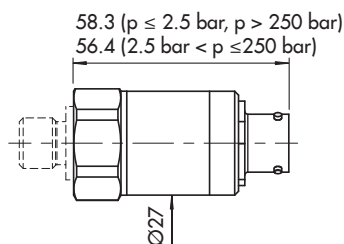


829X.XX.XXXX.02.XX.XX




829X.XX.XXXX.02.XX.32

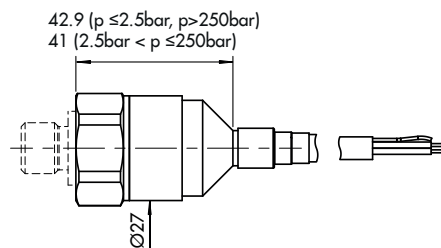


829X.XX.XXXX.78.XX.XX

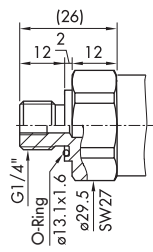


829X.XX.XX.17.XX.XX

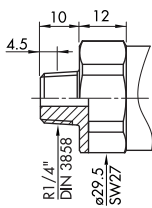


829X.XX.XX.19.04.XX

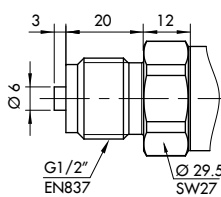


829X.XX.XX.11.XX.XX

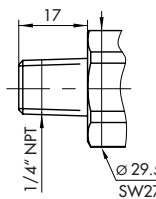


829X.XX.XX.30.XX.XX

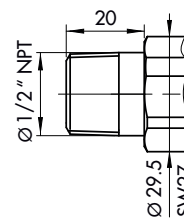


829X.XX.XX.51.XX.XX

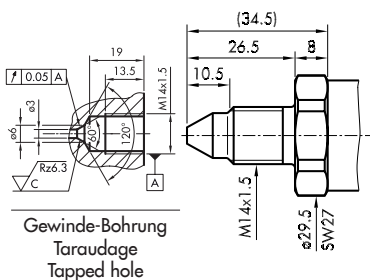


829X.XX.XX.28.XX.XX

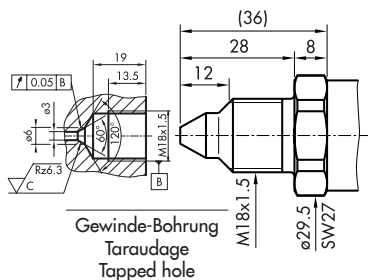

829X.XX.XX.29.XX.XX

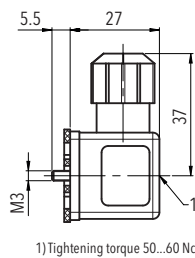

829X.XX.XXXX.XX.XX.46/56

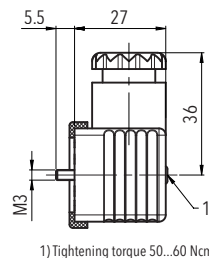

829X.XX.XXXX.XX.XX.58